


PLAN

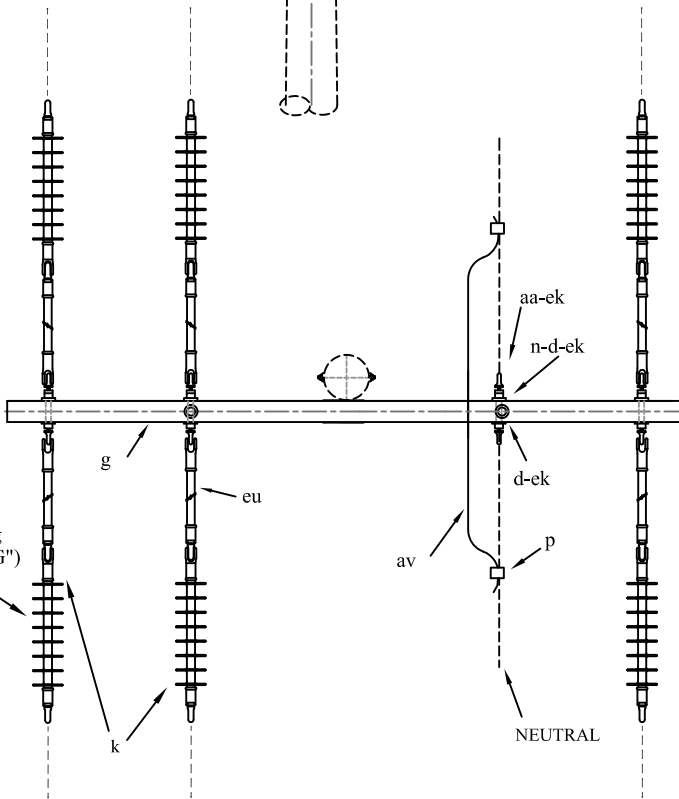

(See Tying Guide "VL 1.2G")

NOTE:

For 2-phase installations, omit switch and related items on center phase and designate as "VS2.21R"

ITEM	NO.	MATERIAL	ITEM	NO.	MATERIAL
c	1	Bolt, machine, 5/8" x req'd. length	sb	3	Switch, disconnect, 27 kv, with mounting hardware
d	2	Washer, square 2 1/4"	ek		Locknuts
g	1	Crossarm, fiberglass	p		Connectors, compression as required
k	6	Insulator, Epoxilator	aa	4	Nut, eye, 5/8"
eu	6	Link, extension, insulated, 18" min	av		Insulated Jumper, as req'd
	2	Bolt, machine 3/4" x 12"		2	Swinging Clevis
	2	Bolt, DA 5/8" x 10"		2	Insulator Spools 4"
	2	3 x 3 x 13/16" Curved Washers		6	DE Shoes
	4	3 x 3 x 11/16" Square Flat Washers			


NOTES:

24.9 / 14.4 KV
DISCONNECT SWITCHES
(THREE SINGLE-PHASE)
336 ACSR Conductor

RUS

03/27/08

Rev. 0

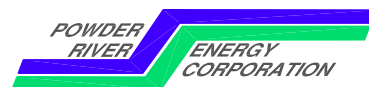

VS2.31LR